



850 Airport Road, Box 7
Lawrenceville, GA 30046
770-962-9092
gwinnettaero.com

Invoice

Date	Invoice #
7/22/2013	3155

Bill To
Charles Mount 9504 Morningwood CT NE Suwanee, GA 30024

Aircraft #	A/C Model	Tach/Hobbs Time	Project	Terms
N3212T	C177	2544.78/377.9	3212T	Due on recpt

Item	Description	Quantity	Rate	Amount
A/S W100	A/S W100 Oil	6	5.87167	35.23T
AA48110-2	Oil Filter	1	22.18	22.18T
D9-14-5	Filter	1	18.42	18.42T
B3-5-1	B3-5-1 Vac Filter	1	2.00	2.00T
MS29513-111	O-ring	1	0.29	0.29T
MS29513-138	O-ring	1	1.01	1.01T
0412007-1	Strap	1	48.76	48.76T
05-00419	Washer (8 pack)	2	18.258	36.52T
15-04985	Anti-seize	1	15.816	15.82T
77611	77611 Gasket	4	9.18	36.72T
350-3-0054	Hose	1	58.968	58.97T
7020	Clamp	1	26.40	26.40T
0756009-8	Fuel Filter Gasket	1	28.56	28.56T
AN23-15	Bolt	1	1.188	1.19T
8L8F	Bearing	4	5.82	23.28T
6L6F	Bearing	2	5.208	10.42T
CR3213-4-3	Rivet	3	0.6024	1.81T
455-0012	ELT Battery	1	180.00	180.00T
	SUBTOTAL PARTS			547.58
GREASE/SOL	GREASE/SOLVENT	1	20.00	20.00T
SHIPPING	SHIPPING		27.70	27.70
LABOR	Annual Inspection	1	1,170.00	1,170.00
LABOR	Additional Labor	20.3	78.00	1,583.40
Due upon receipt. Interest may be charged on overdue balances. A 3.0% electronic transaction fee will apply to credit card payments		Total		



850 Airport Road, Box 7
Lawrenceville, GA 30046
770-962-9092
gwinnettaero.com

Invoice

Date	Invoice #
7/22/2013	3155

Bill To
Charles Mount 9504 Morningwood CT NE Suwanee, GA 30024

Aircraft #	A/C Model	Tach/Hobbs Time	Project	Terms
N3212T	C177	2544.78/377.9	3212T	Due on recpt

Item	Description	Quantity	Rate	Amount
	<p>Engine: Drained oil. Removed and cut open filter for inspection. No abnormalities noted. Installed new filter. Serviced engine with 6 quarts of AeroShell W100 Plus oil. Pressure tested heat exchanger – no leaks noted. Tailpipe clamp loose – removed exhaust and cleaned slip joints. Reassembled and installed using antiseize and new gaskets. Serviced induction air filter. Greased and dressed leading edges of prop. No paint needed.</p> <p>Airframe: Removed, charged, and serviced battery. Reinstalled with new ground strap. ELT inspected per FAR 91.207(d). Installed new battery. Ops check OK. Removed, cleaned, inspected and reinstalled fuel filter using new o-rings. Leak check OK. Replaced vacuum filters with new. Serviced brake reservoir with fluid. Nose gear torque links have play at bushings – replaced bushings with new. Avgas placards missing – installed on both fuel gas caps. Clevis bolt on shimmy dampner worn down – replaced bolt with new. Center rudder hinge missing rivets – installed rivets. Ops check OK. No compass correction card – preformed compass swing. LH aileron attach structure has small crack – stop drilled. RH brake line at caliper deteriorated – replaced with new. Ops check OK.</p> <p>AD's: Compiled an up to date equipment list and performed AD research. Performed AD 2011-10-09 seat tracks – 2 required, only 1 each installed. Replaced old washers and installed where washers were missing. Found seat frames not built to proper dimensions. Removed rivets on intercoasters and installed spacer material. Re-riveted. Ops check OK. Performed AD 76-07-12 Bendix switch, checks OK. Completed logbook entries, AD compliance report and all paperwork.</p> <p>SALES TAX</p>		6.00%	34.05
Due upon receipt. Interest may be charged on overdue balances. A 3.0% electronic transaction fee will apply to credit card payments		Total		\$3,382.73